

1 Products affected

Product hierarchy no. *			Part no.	SBU	Type / Description	Customer part no.
SBU	PG	PGU	Type			
02	007	003	0000002298	See list below	Appliance Inlet	4798

*SBU (2-digit) / PG (3-digit) / PGU (3-digit) / Type (10-digit)


List of part numbers affected				
4798.9000	4798.9100	4798.9200	4798.9000.15	4798.9000.21
4798.9100.15	4798.9100.21	4798.9200.15	4798.9200.21	

2 Type of change

Change of material, V-Lock cord retaining feature as standard.

3 Detailed description of change

- Material change from PA6 to PA66/6 to pass the enhanced requirements of glow wire test acc. to IEC 60695-2-12 and -13
- V-Lock feature integrated as standard (not an option anymore)
- Flange will have a new form on the back side to improve molding process.

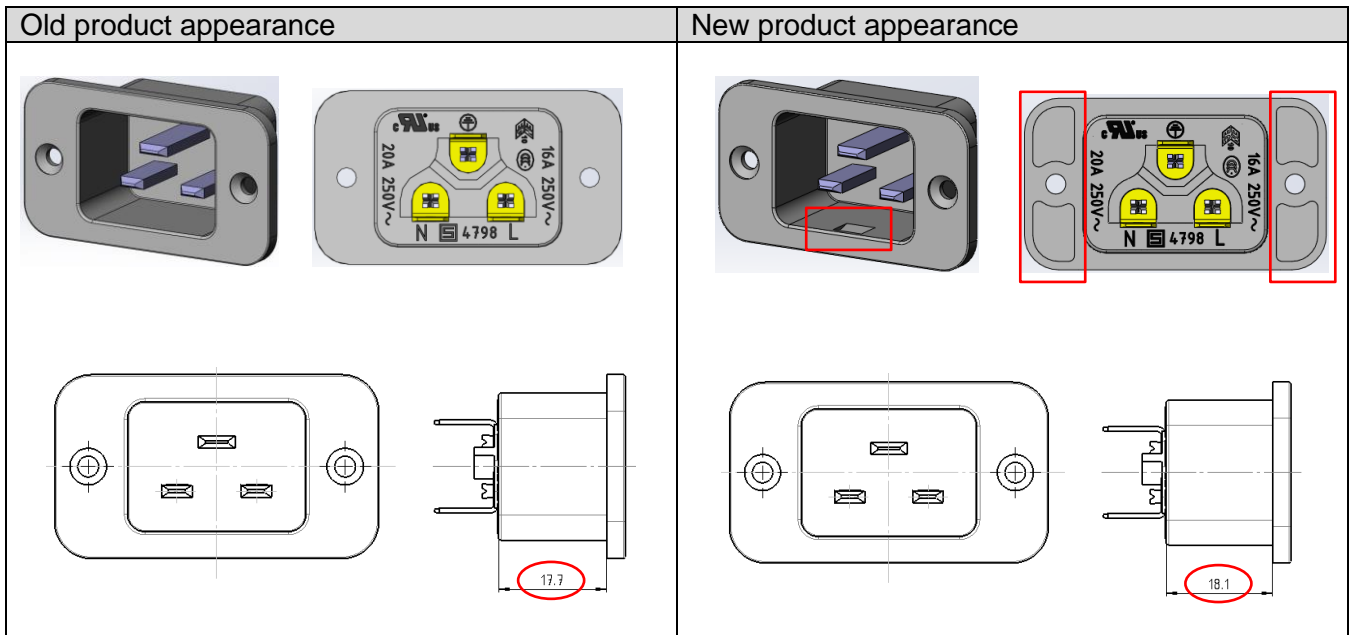

As the V-Lock notch and material for enhanced glow wire tests will be standard features, the material numbers with index .15 and .21 are obsolete and will be replaced by the standard numbers:

4798.9000.15 ⇒ 4798.9000	4798.9100.15 ⇒ 4798.9100	4798.9200.15 ⇒ 4798.9200
4798.9000.21 ⇒ 4798.9000	4798.9100.21 ⇒ 4798.9100	4798.9200.21 ⇒ 4798.9200

4 Reason of change

- Change of material
- V-Lock feature implemented as a standard feature.

Product Change Notification					PCN 4798		
owner	creation date	release date	released by	change order no	rev	page	0118.2322
hotzar	2015-12-05	2016-03-14	stadelt1	2009470	A	1 of 2	

5 Release date

The change takes effect in ww 15/2016 (Date code 1615 or higher on label).

6 Impact of change and recommended action

Form	Yes	Yes Socket has notch for V-Lock cord retaining, flange new form on the back side, extended socket dimension.
Fit	Yes	Yes, installation depth is 0.4 mm extended.
Function	Yes	V-Lock feature is standard (not an option anymore)
Production Site	No	There is no change of the production site
Product Label	No	No label change
Customer Action	No	Check installation depth in the application. Change SCHURTER part number if affected.

7 Reference Documents / Attachments

Kind of document	Remarks
Data Sheet 4798	

Product Change Notification						PCN 4798	
owner	creation date	release date	released by	change order no	rev	page	0118.2322
hotzar	2015-12-05	2016-03-14	stadelt1	2009470	A	2 of 2	